

Software Update Notification

You will need a Windows-compatible computer and a (pin to pin) RS-232 cable.

☐ RECOMMEND UPDATING ALL UNITS.

☐ UPDATE UNITS S/N: _____
PLEASE ADVISE CUSTOMERS AND UPDATE UNITS ONLY WHERE APPLICABLE.

☒ NEW FEATURES ADDED IN THIS SOFTWARE RELEASE ARE INTENDED TO IMPROVE OPERATION/PERFORMANCE. UPDATE IS OPTIONAL.

Dependencies and requirements for this software update (this info is accessible through pressing: MENU-STATUS->VERSION INFO):

Release Notes: The software update will provide functionality/ usability improvements to the features and capabilities of this model. These are as follows:

- Updated the DSP to version 2.10.0
- Added the Dolby Volume feature, selectable by input
- Added support for Dolby TrueHD DRC auto mode
- Added a True Pink Noise feature which will generate full range pink noise when the speaker select button is pressed in the PEQ setup page. This eliminates the need for an external noise source for measuring in room response during the PEQ setup.
- Added an OSD offset control to enable vertical repositioning of the OSD image for improved visibility with 2:35 aspect ratio screen modes
- Fixed "no audio after hard boot" problem that occurred when no HDMI sink was connected or powered on.
- Fixed potential loss of audio issue related to some sources using HDMI input #1 interacting poorly with the standby pass thru feature
- Fixed speaker distance control for Configuration 6 Right Front speaker
- Fixed PEQ Group enable for Left Rear speaker
- Revised headroom calculations for phantom center channel configurations
- Fixed DTS HD Master Audio reporting for 8.0 channel streams
- Fixed potential coax/TOSLINK input sample rate reporting errors
- Fixed downmix issue with DRC being enabled in Dolby modes when Center channel is set to none
- Fixed potential display update issue when switching between Dolby PLIIx modes